Oklahoma Corporation Commission
Oil & Gas Conservation Division
Post Office Box 52000
Oklahoma City, Oklahoma 73152-2000
Rule 165: 10-3-25

Form 1002A

API No.: 35087220500000

OTC Prod. Unit No.: 08721801600000

Completion Report

Spud Date: June 07, 2016

Drilling Finished Date: July 23, 2016

1st Prod Date: November 13, 2016

Completion Date: October 17, 2016

Drill Type: **HORIZONTAL HOLE**

Well Name: DESPAIN 2H-20

Purchaser/Measurer: WOODFORD EXPRESS

First Sales Date: 11/13/2016

Location: MCCLAIN 20 5N 4W
SW SE SW SW
175 FSL 740 FWL of 1/4 SEC
Latitude: -97.650558 Longitude: 34.884775
Derrick Elevation: 1114 Ground Elevation: 1092

Operator: CITIZEN ENERGY II LLC 23559

320 S BOSTON AVE STE 1300
TULSA, OK 74103-4702

Completion Type	
X	Single Zone
	Multiple Zone
	Commingled

Location Exception
Order No
654622
653082

Increased Density
Order No
There are no Increased Density records to display.

Casing and Cement

Type	Size	Weight	Grade	Feet	PSI	SAX	Top of CMT
CONDUCTOR	16			60		8	SURFACE
SURFACE	9.625	40	J-55	1032		384	SURFACE
INTERMEDIATE	7	29	HCP-110	10205		419	7521

Liner

Type	Size	Weight	Grade	Length	PSI	SAX	Top Depth	Bottom Depth
LINER	4.5	13.5	HCP-110	4651	0	487	9889	14540

Total Depth: 14899

Packer	
Depth	Brand & Type
9866	EXPRO ASIII

Plug	
Depth	Plug Type
There are no Plug records to display.	

Initial Test Data

Test Date	Formation	Oil BBL/Day	Oil-Gravity (API)	Gas MCF/Day	Gas-Oil Ratio Cu FT/BBL	Water BBL/Day	Pumpin or Flowing	Initial Shut-In Pressure	Choke Size	Flow Tubing Pressure
Nov 14, 2016	SYCAMORE	190	48	2473	13016	701	FLOWING		30/64	1151

Completion and Test Data by Producing Formation

Formation Name: SYCAMORE Code: 352SCMR Class: OIL

Spacing Orders

Order No	Unit Size
653300	640

Perforated Intervals

From	To
10422	14528
14533	14899

Acid Volumes

13500 GALLONS

Fracture Treatments

242,105 BBLS; 10,841,401 POUNDS OF PROPPANT

Formation	Top
INOLA LIMESTONE	8725
SPRINGER SHALE	9050
CANEY SHALE	9768

Were open hole logs run? No
Date last log run:

Were unusual drilling circumstances encountered? No
Explanation:

Other Remarks

PERFORATED INTERVALS 14,533' - 14,899' ARE OPEN HOLE.
OCC: FLE ORDER HAS NOT BEEN ISSUED. WE HAVE ACCEPTED OPERATORS DATA AS SUBMITTED. IRREGULAR SECTION.

Lateral Holes

Sec: 20 TWP: 5N RGE: 4W County: MCCLAIN

SE NW NW NW

505 FNL 382 FWL of 1/4 SEC

Depth of Deviation: 9409 Radius of Turn: 369 Direction: 359 Total Length: 4567

Measured Total Depth: 14899 True Vertical Depth: 9528 End Pt. Location From Release, Unit or Property Line: 382

FOR COMMISSION USE ONLY

1135052

Status: Accepted

Sec. 20-5N-4W I.M.

Well Location Plat

API 087-22050

Operator CITIZEN ENERGY, LLC
Lease Name and No. DeSPAIN #2H-20
Footage : 175' FSL - 740' FWL GR. ELEVATION : 1092' Good Site? YES
Section : 20 Township : 5N Range : 4W I.M.
County : McClain State of Oklahoma
Alternate Loc. : N/A
Terrain at Loc. Location fell on top of a hill. ±290' Northwest of an existing SW-NE Duke Energy pipeline.
Accessibility : From the South.
Directions : From the junction of State Hwy 19 & State Hwy 76 in Lindsay, OK, go 4.4 miles North on Hwy 76, go 1.3 miles West on "130th St.," and go 1.0 mile South on "Council Ave." to the Southwest Corner of Section 20-5N-4W

0' 500' 1000' 1500'
1"=1000'

BASIS OF BEARING:
GRID NORTH - NAD 27
STATE PLANE - OK SOUTH ZONE

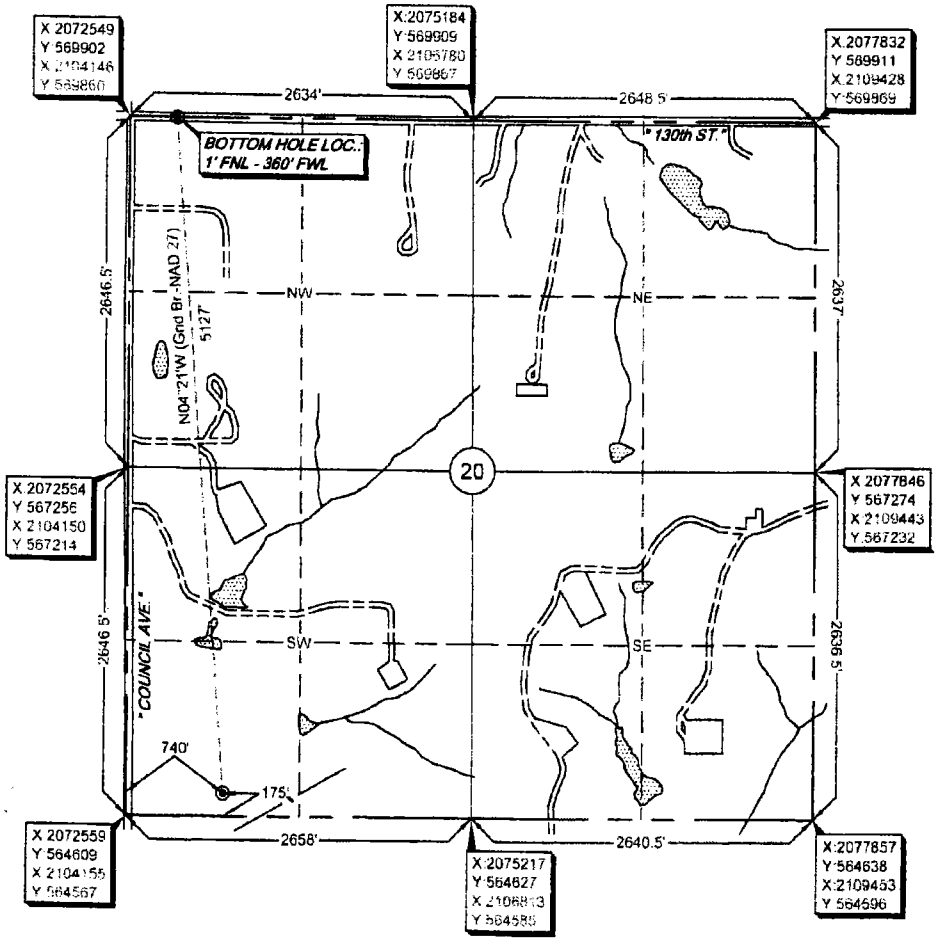

GPS DATUM
NAD - 83
OK SOUTH ZONE

GPS DATUM
NAD - 27
OK SOUTH ZONE

Surface Hole Loc.:
Lat: 34°53'05.19"N
Lon: 97°39'02.01"W
X: 2073299
Y: 564789

Surface Hole Loc.:
Lat: 34°53'04.93"N
Lon: 97°39'00.89"W
X: 2104895
Y: 564747

Bottom Hole Loc.:
Lat: 34°53'55.78"N
Lon: 97°39'06.47"W
X: 2072909
Y: 569902

Bottom Hole Loc.:
Lat: 34°53'55.52"N
Lon: 97°39'05.35"W
X: 2104506
Y: 569860

Please note that this location was staked on the ground under the supervision of a Licensed Professional Land Surveyor, but the accuracy of this survey is not guaranteed. Please contact Arkoma Surveying and Mapping promptly if any inconsistency is determined. GPS data is observed from RTK - GPS.

NOTE: X and Y data shown hereon for Section Corners may NOT have been surveyed on the ground and further does NOT represent a true Boundary Survey.

Quarter Section distances may be assumed from a Government Survey Plat or assumed at a proportionate distance from opposing section corners or occupation thereof and may not have been measured on the ground and further does not represent a true boundary survey.

survey and plat by
Arkoma Surveying and Mapping, PLLC
P.O. Box 238 Wilburton, OK 74578
Ph. 918-465-5711 Fax 918-465-5030
Certificate of Authorization No 5348
Expires June 30, 2016

Invoice #6029-A
Date Staked : 12/07/15 By : H.N.
Date Drawn : 12/17/15 By : K.M.
Rev. Lse. Name : 02/24/16 By: J.H.

Certification
This is to certify that this Well Location Plat represents the results of a survey made on the ground performed under the supervision of the undersigned.

02/25/16
LANCE G. MATHIS OK LPLS 1664

LICENSED PROFESSIONAL LAND SURVEYOR
LANCE G. MATHIS
1664
OKLAHOMA